

# Bulletin technique

**Date d'émission** : 11 Mai 2017

**Marque** : Sierra Wireless

**Date d'application** : Immédiat

**Technologie** : Cellulaire

**Type** : Dysfonctionnement/Correctif/Novauté / Astuce

**Produit(s) concerné(s)** : ES450, GX450, RV50, RV50X et MP70

**Intitulé** : Mise à jour du firmware ALEOS 4.8.0



## Contenu

1. Vérifiez la version logicielle et radio de votre passerelle Airlink : ..... 2
2. Choix du firmware en fonction de votre produit Airlink ..... 2
3. Téléchargement du firmware 4.8.0 ..... 3
4. Mise à jour du firmware des routeurs de la gamme Airlink..... 3


Ce bulletin fournit des informations concernant la mise à jour du firmware ALEOS sur les routeurs ES450, GX450, RV50, RV50X et MP70. Cette mise à jour est conseillée mais pas obligatoire.

Celle-ci contient un certain nombre de nouvelles fonctionnalités, y compris :

- Ethernet WAN
- Priorité et basculement de l'interface WAN
- Routage statique
- SSID multiples lorsque le périphérique est dans le WLAN AP
- Enregistrement à distance

## 1. Vérifiez la version logicielle et radio de votre passerelle Airlink :


### Status / About

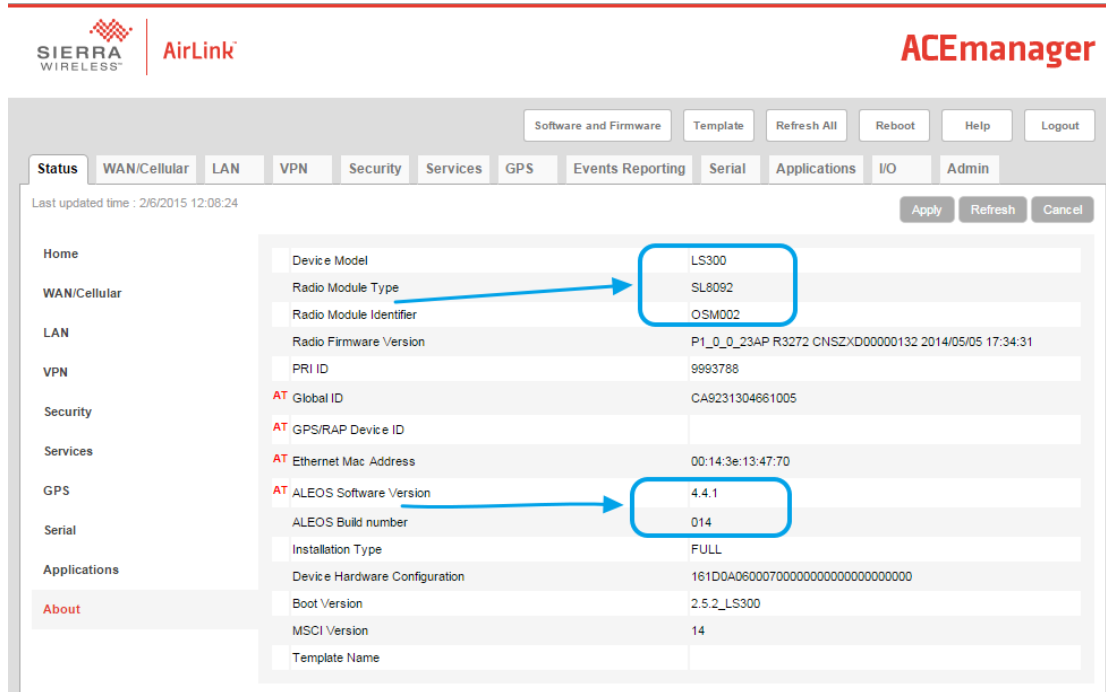

The screenshot shows the 'About' section of the ACEmanager interface. The following table represents the data shown in the interface:

Device Model	LS300
Radio Module Type	SL8092
Radio Module Identifier	OSM002
Radio Firmware Version	P1_0_0_23AP R3272 CNSZKD00000132 2014/05/05 17:34:31
PRI ID	9993788
AT Global ID	CA9231304661005
AT GPS/RAP Device ID	
AT Ethernet Mac Address	00:14:3e:13:47:70
AT ALEOS Software Version	4.4.1
ALEOS Build number	014
Installation Type	FULL
Device Hardware Configuration	161D0A0600070000000000000000000000
Boot Version	2.5.2_LS300
MSCI Version	14
Template Name	


## 2. Choix du firmware en fonction de votre produit Airlink

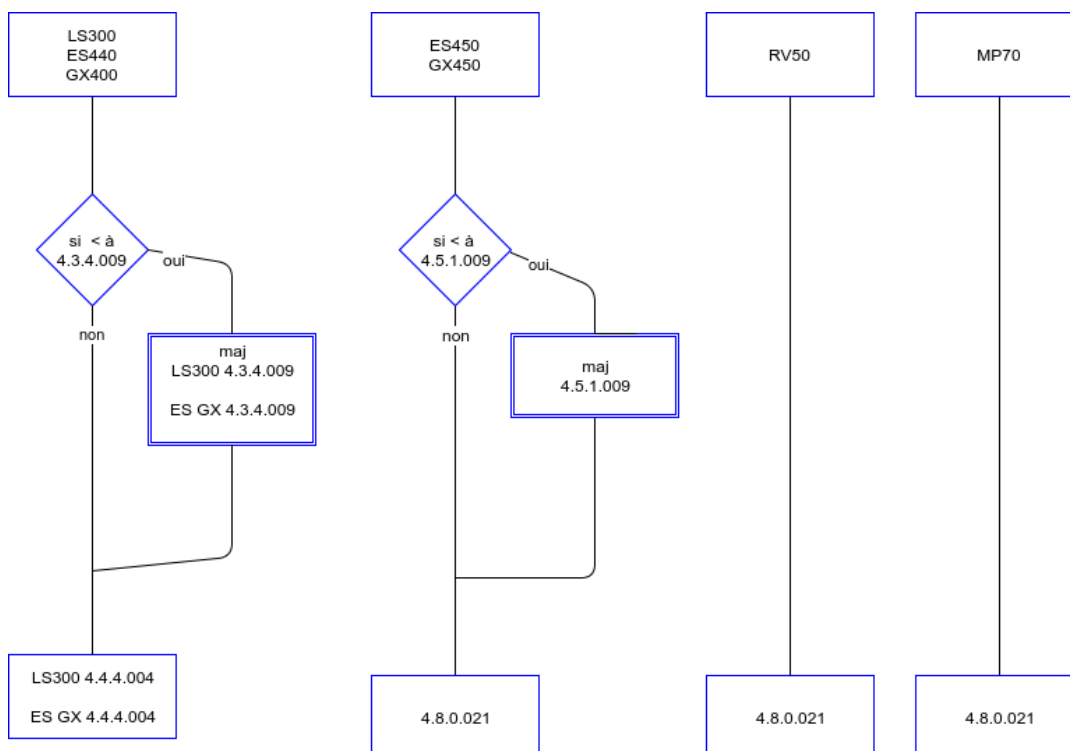

### 3. Téléchargement du firmware 4.8.0

- Pour les ES450 :  
[https://source.sierrawireless.com/resources/airlink/software\\_downloads/es450/es450-firmware-packages-for-international/](https://source.sierrawireless.com/resources/airlink/software_downloads/es450/es450-firmware-packages-for-international/)
- Pour les GX450 :  
[https://source.sierrawireless.com/resources/airlink/software\\_downloads/gx450/gx450-firmware-packages-for-international/](https://source.sierrawireless.com/resources/airlink/software_downloads/gx450/gx450-firmware-packages-for-international/)
- Pour le RV50 :  
[https://source.sierrawireless.com/resources/airlink/software\\_downloads/rv50/rv50-firmware-list/](https://source.sierrawireless.com/resources/airlink/software_downloads/rv50/rv50-firmware-list/)
- Pour le RV50X :  
[https://source.sierrawireless.com/resources/airlink/software\\_downloads/rv50/rv50-firmware-list/](https://source.sierrawireless.com/resources/airlink/software_downloads/rv50/rv50-firmware-list/)
- Pour le MP70 :  
[https://source.sierrawireless.com/resources/airlink/software\\_downloads/mp70/mp70-firmware-list/](https://source.sierrawireless.com/resources/airlink/software_downloads/mp70/mp70-firmware-list/)
- Informations complémentaires sur les routeurs  
<http://www.ebds.eu/produits/modems-et-routeurs-gsm/>

### 4. Mise à jour du firmware des routeurs de la gamme Airlink

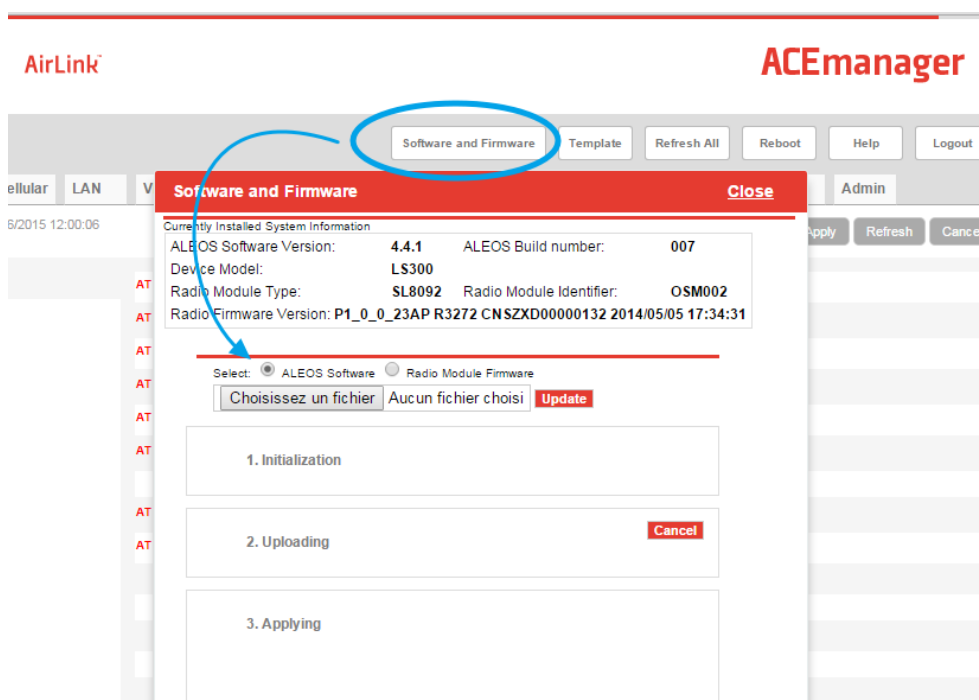

## **Plus d'informations**

Pour plus d'informations ou un support technique, n'hésitez pas à nous contacter au 09 72 36 76 46 ou par email à [info@ebds.eu](mailto:info@ebds.eu)

*EBDS décline toute responsabilité quant à l'utilisation des informations contenues dans ce document. Celles-ci sont uniquement fournies à titre informatif et n'entraînent aucune obligation légale.*